

FLOOD CONTROL DISTRICT OF MARICOPA COUNTY

APACHE JUNCTION FRS

F.C.D. CONTRACT NO. FCD 93-51

LEGEND

100-YR FLOODPLAIN BOUNDARY	---
FLOODWAY BOUNDARY	---
HYDRAULIC BASE LINE WITH RIVER MILE	M12.0 --- M13.0
CROSS SECTION	(A) FP=100 Yr WSE (A) FW=Floodway WSE
ELEVATION REFERENCE MARK	ERM3 X
BASE FLOOD ELEVATIONS	1221
ZONE DESIGNATIONS	ZONE AE
CORPORATE LIMITS	Corporate Limits
COUNTY, PARISH, STATE OR INTERNATIONAL BOUNDARY	County Boundary



PRIMARY CONTROL POINTS

NOTE: ALL ELEVATIONS ARE BASED ON NAVD 88 (NORTH AMERICAN VERTICAL DATUM 1988)

I.D. NO.	ELEV. (FT)	DESCRIPTION/LOCATION
4001	1792.16	Found Alum. Cap in concrete (flush) marked "PT" at base of dam near Sta. 45+00.
4002	1814.56	Set 1/2" rebar (flush) at Southeast end of dam on track road along the South side of the concrete drainage structure leading into ponding area. Point is +/- 6' South of concrete wall of a small rise in dirt trail.
4003	1822.25	Set 1/2" rebar (flush) +/- 120' South of the center line of Lost Dutchman Blvd., 1600' West of Tomahawk Rd.
4004	1815.52	Set PK nail (flush) in South driveway entrance to Prospector Park +/- 0.4 miles North of Lost Dutchman on Idaho Rd.
4005	1812.42	Set 1/2" rebar (flush) on top of dam next to Station Marker 10+00.
4006	1813.03	Found 1/2" rebar in concrete (flush) 1 Foot South of "PT" post at North end of dam and West of track road at end of dam.
4007	1817.03	Set 1/2" rebar (flush) 150' North of Lost Dutchman Blvd. 1/2 mile East of Idaho Rd.
8213	1814.04	Found cotton picker spindle in asphalt (flush) at the center of the intersection of Idaho & Lost Dutchman Blvd. (Assumed Section Corner for Sections 8.9.16 & 17, T1N, R8E).
8218	1820.98	Found BC (flush) in center line of Idaho Rd. 1/2 mile North of Lost Dutchman (Assumed 1/4 corner for Sections 8 & 9, T1N, R8E).





INDEX MAP

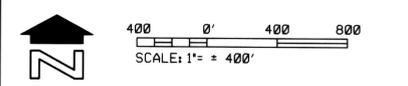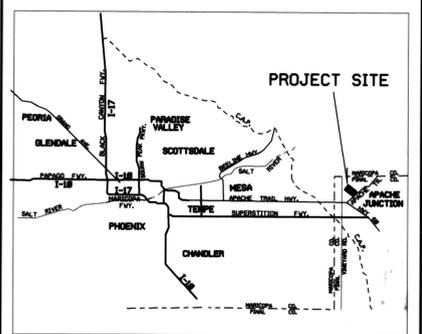

McLAIN HARBERS CO., INC

DESIGN	BY	DATE	FLOOD CONTROL DISTRICT OF MARICOPA COUNTY
DESIGN CHK.	-	-	
PLANS	-	-	RECOMMENDED BY: DATE
PLANS CHK.	-	-	APPROVED BY: DATE
SUBMITTED BY:	-	-	CHIEF ENGINEER AND GENERAL MANAGER
DATE:	-	-	SHEET INDEX

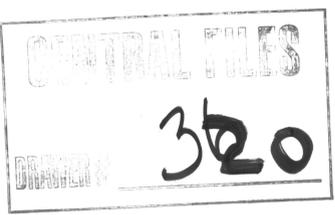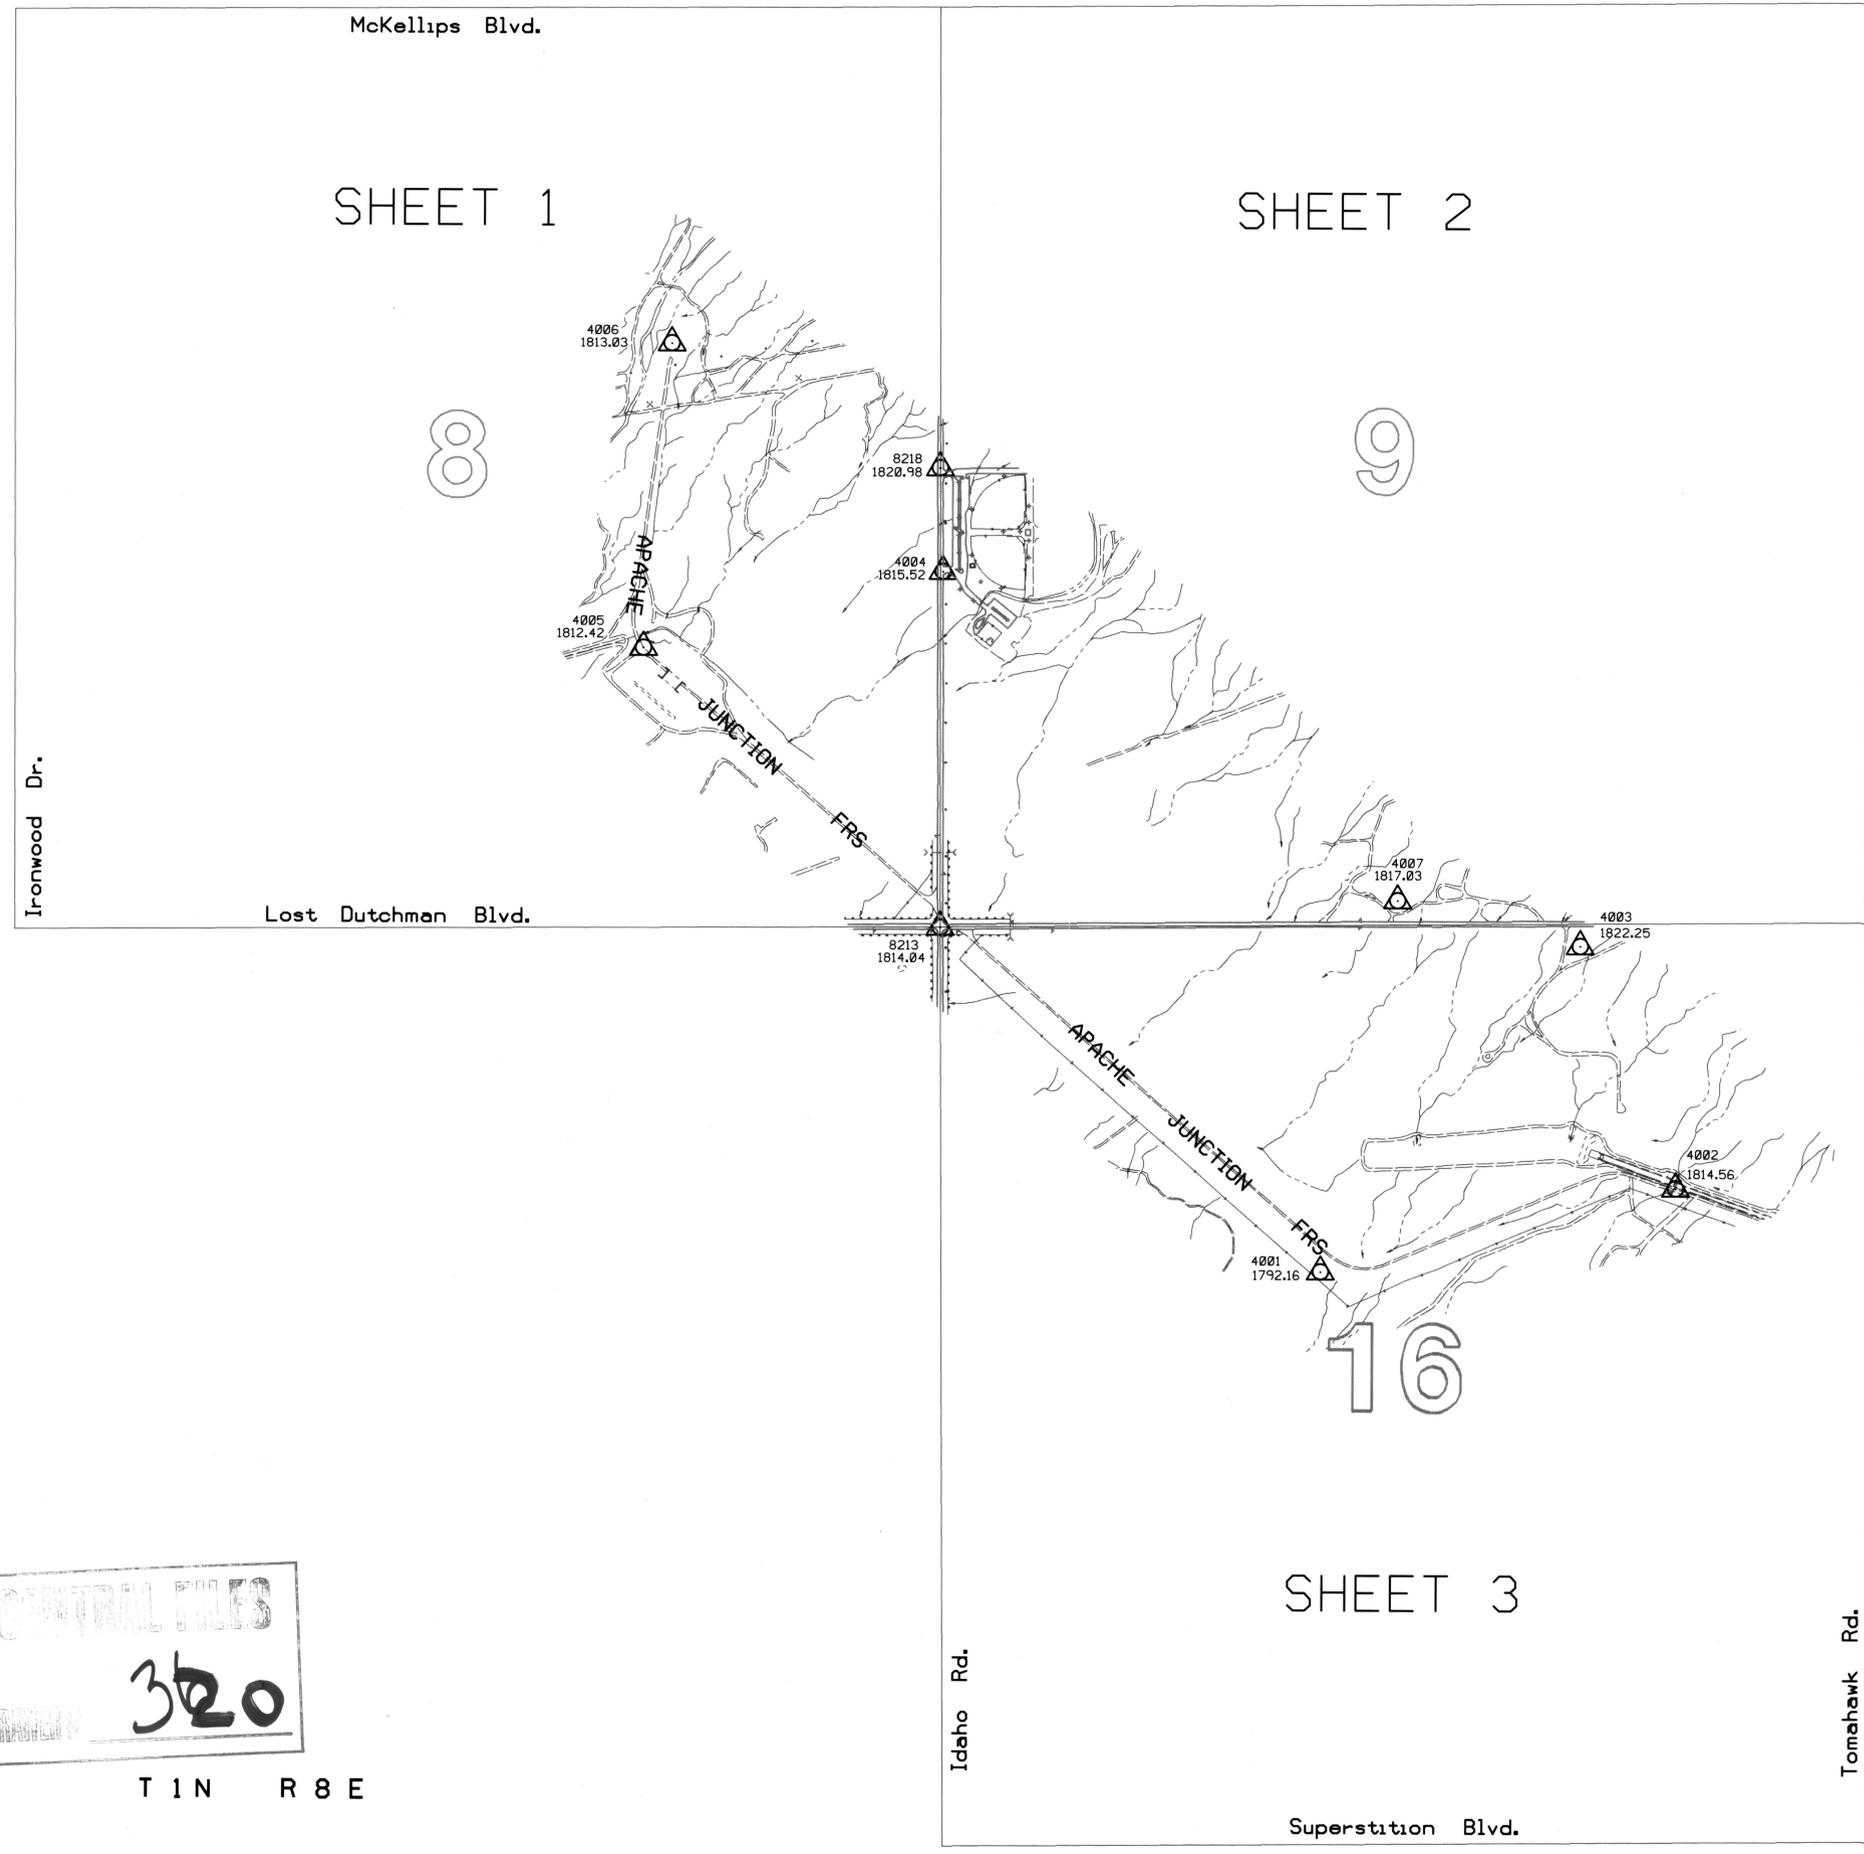

T 1 N R 8 E

APACHE JUNCTION FRS
ELEVATION CAPACITY CURVE-AERIAL
TOPD'S BY McLain Harbers
FCD 93-51
320
McLain Harbers, Co. - Aerial Mapping Co.
Collins Pina Const. Engineers-Surveying Co.
Photo Date 5-18-95

ADUMBER REV. DEC. 18, 1991

**FLOOD CONTROL DISTRICT
OF MARICOPA COUNTY**

APACHE JUNCTION FRS

F.C.D. CONTRACT NO. FCD 93-51

LEGEND

100-YR FLOODPLAIN BOUNDARY	---
FLOODWAY BOUNDARY	---
HYDRAULIC BASE LINE WITH RIVER MILE	M12.0 --- M13.0
CROSS SECTION	(A) FP=100 Yr WSE (B) FW=Floodway WSE
ELEVATION REFERENCE MARK	ERM3 X
BASE FLOOD ELEVATIONS	~ 1221 ~
ZONE DESIGNATIONS	ZONE AE
CORPORATE LIMITS	Corporate Limits
COUNTY, PARISH, STATE OR INTERNATIONAL BOUNDARY	County Boundary

PRIMARY CONTROL POINTS

NOTE: ALL ELEVATIONS ARE BASED ON NAVD 88 (NORTH AMERICAN VERTICAL DATUM 1988)

I.D. NO.	ELEV. (FT)	DESCRIPTION/LOCATION
4004	1815.52	Set PK nail (flush) in South driveway entrance to Prospector Park, +/- 0.4 miles North of Lost Dutchman on Idaho Rd.
4005	1812.42	Set 1/2" rebar (flush) on top of dam next to Station Marker 10+00.
4006	1813.03	Found 1/2" rebar in concrete (flush) 1 Foot South of "T" post at North end of dam and West of track road at end of dam.
8213	1814.04	Found cotton picker spindle in asphalt (flush) at the center of the intersection of Idaho & Lost Dutchman Blvd. (Assumed Section Corner for Sections 8, 9, 16 & 17, T1N, R8E).
8218	1820.98	Found BC (flush) in center line of Idaho Rd. 1/2 mile North of Lost Dutchman (Assumed 1/4 corner for Sections 8 & 9, T1N, R8E).



NOTES



INDEX MAP


Map Sheet 1 represents Section 8, T1N, R8E

T 1 N R 8 E

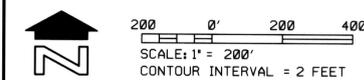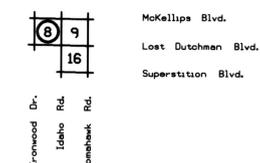

McLAIN HARBERS CO., INC

DESIGN	BY	DATE	FLOOD CONTROL DISTRICT OF MARICOPA COUNTY
DESIGN CHK.	-	-	
PLANS	-	-	RECOMMENDED BY: _____ DATE _____
PLANS CHK.	-	-	APPROVED BY: _____ DATE _____
SUBMITTED BY:	DATE		CHIEF ENGINEER AND GENERAL MANAGER
			SHEET 1 OF 3

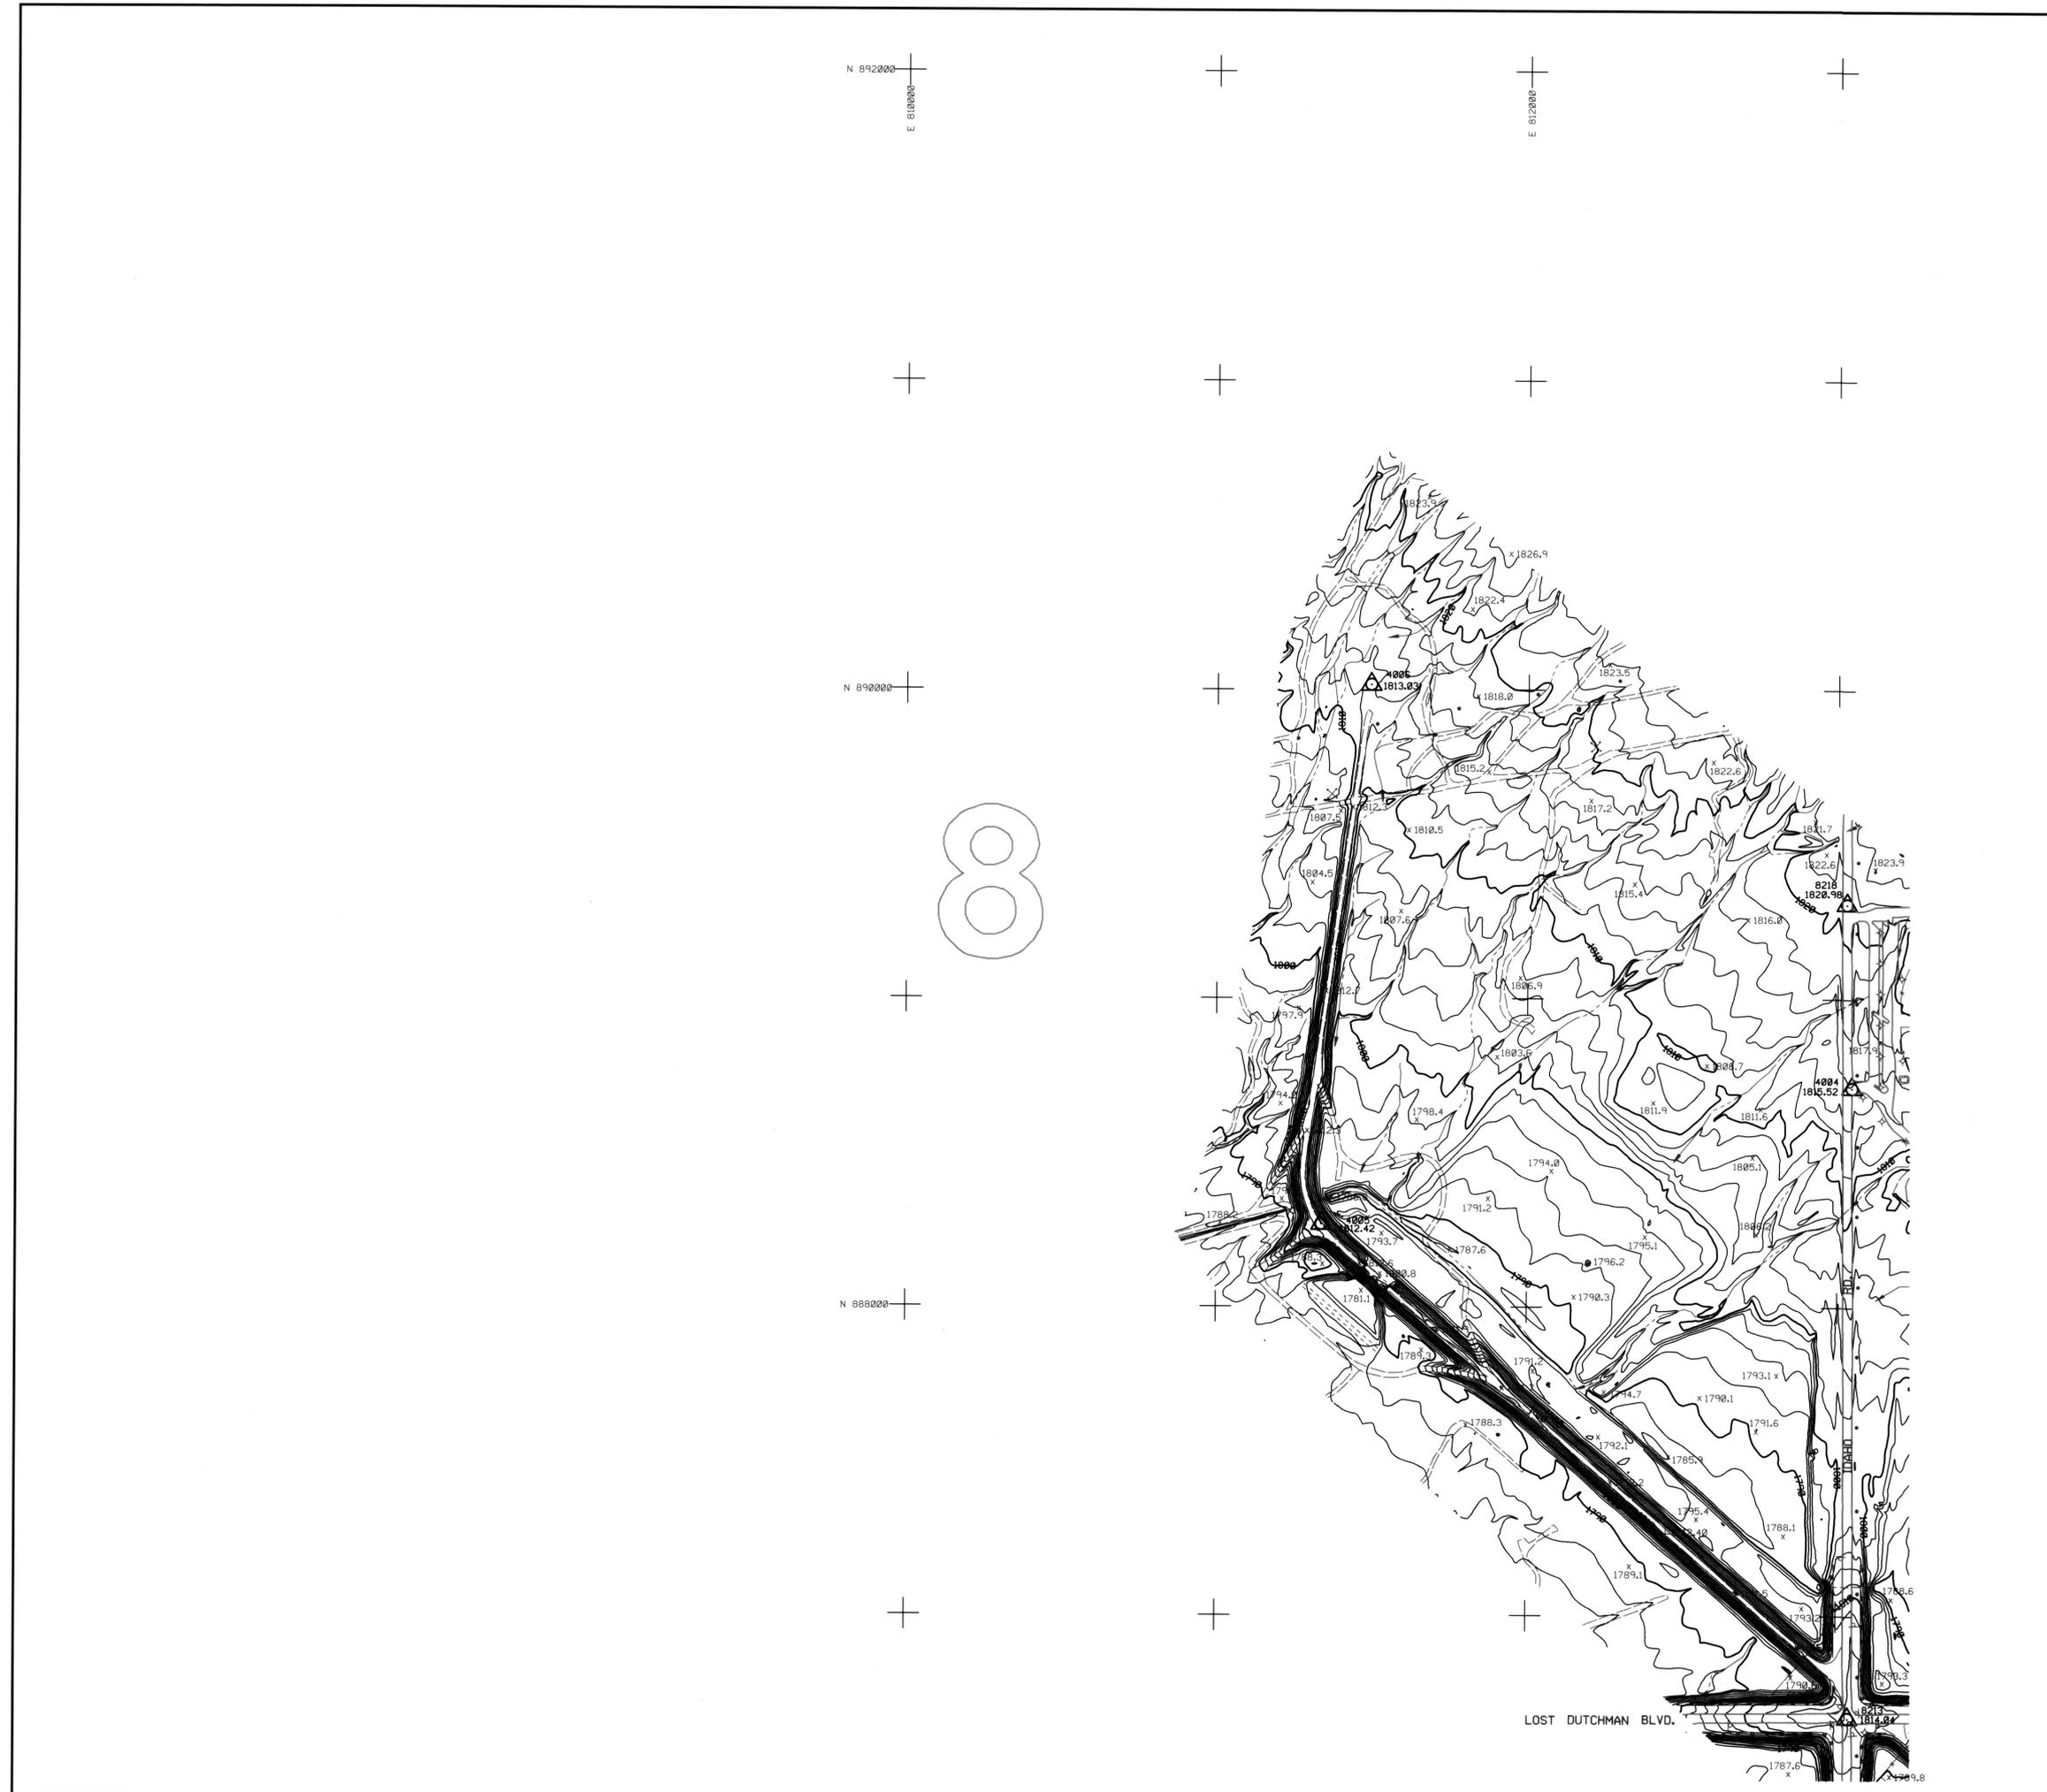

**FLOOD CONTROL DISTRICT
OF MARICOPA COUNTY**

APACHE JUNCTION FRS

F.C.D. CONTRACT NO. FCD 93-51

LEGEND

100-YR FLOODPLAIN BOUNDARY	-----
FLOODWAY BOUNDARY	-----
HYDRAULIC BASE LINE WITH RIVER MILE	M12.0 ----- M13.0
CROSS SECTION	(A) FP=100 Yr WSE (A) FW=Floodway WSE
ELEVATION REFERENCE MARK	ERM3 X
BASE FLOOD ELEVATIONS	~~~~~ 1221 ~~~~~
ZONE DESIGNATIONS	ZONE AE
CORPORATE LIMITS	Corporate Limits
COUNTY, PARISH, STATE OR INTERNATIONAL BOUNDARY	County Boundary

PRIMARY CONTROL POINTS

NOTE: ALL ELEVATIONS ARE BASED ON NAVD 88 (NORTH AMERICAN VERTICAL DATUM 1988)

I.D. NO.	ELEV. (FT)	DESCRIPTION/LOCATION
4003	1822.25	Set 1/2" rebar (flush) +/- 120' South of the center line of Lost Dutchman Blvd., 1600' West of Tomahawk Rd.
4004	1815.52	Set PK nail (flush) in South driveway entrance to Prospector Park, +/- 0.4 miles North of Lost Dutchman on Idaho Rd.
4007	1817.03	Set 1/2" rebar (flush) 150' North of Lost Dutchman Blvd. 1/2 mile East of Idaho Rd.
8213	1814.04	Found cotton picker spindle in asphalt (flush) at the center of the intersection of Idaho & Lost Dutchman Blvd. (Assumed Section corner for Sections 8, 9, 16 & 17, TIN, RBE).
8218	1820.98	Found BC (flush) in center line of Idaho Rd. 1/2 mile North of Lost Dutchman (Assumed 1/4 corner for Sections 8 & 9, TIN, RBE).



NOTES



INDEX MAP

Map Sheet 2 represents Section 9, TIN, RBE

T 1 N R 8 E

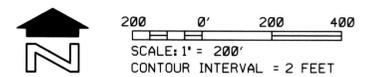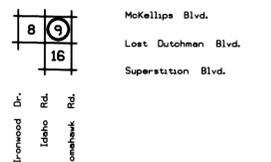

McLAIN HARBERS CO., INC

DESIGN	BY	DATE	FLOOD CONTROL DISTRICT OF MARICOPA COUNTY
DESIGN CHK.	-	-	RECOMMENDED BY: DATE
PLANS	-	-	APPROVED BY: DATE
PLANS CHK.	-	-	CHEF ENGINEER AND GENERAL MANAGER
SUBMITTED BY:	DATE:	SHEET	2 OF 3



**FLOOD CONTROL DISTRICT
OF MARICOPA COUNTY**

APACHE JUNCTION FRS

F.C.D. CONTRACT NO. FCD 93-51

LEGEND

100-YR FLOODPLAIN BOUNDARY	---
FLOODWAY BOUNDARY	---
HYDRAULIC BASE LINE WITH RIVER MILE	M12.0 --- M13.0
CROSS SECTION	A FP=100 Yr WSE A FW=Floodway WSE
ELEVATION REFERENCE MARK	ERM3 X
BASE FLOOD ELEVATIONS	---1221---
ZONE DESIGNATIONS	ZONE AE
CORPORATE LIMITS	Corporate Limits
COUNTY, PARISH, STATE OR INTERNATIONAL BOUNDARY	County Boundary

PRIMARY CONTROL POINTS

NOTE: ALL ELEVATIONS ARE BASED ON NAVD 88 (NORTH AMERICAN VERTICAL DATUM 1988)

I.D. NO.	ELEV. (FT)	DESCRIPTION/LOCATION
4001	1792.16	Found Alum. Cap in concrete (flush) marked "PI" at base of dam near Sta. 45+00.
4002	1814.56	Set 1/2" rebar (flush) at Southeast end of dam on track road along the South side of the concrete drainage structure leading into ponding area. Point is +/- 6' South of concrete wall at a small rise in dirt trail.
4003	1822.25	Set 1/2" rebar (flush) +/- 120' South of the center line of Lost Dutchman Blvd., 1600' West of Tomhawk Rd.
4007	1817.03	Set 1/2" rebar (flush) 150' North of Lost Dutchman Blvd. 1/2 mile East of Idaho Rd.
8213	1814.04	Found cotton picker spindle in asphalt (flush) at the center of the intersection of Idaho & Lost Dutchman Blvd. (Assumed Section Corner for Sections 8.9.16 & 17, TIN, RBE).



NOTES



INDEX MAP


Map Sheet 3 represents Section 16, TIN, RBE

T I N R B E

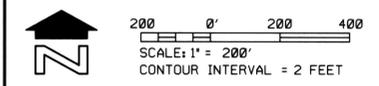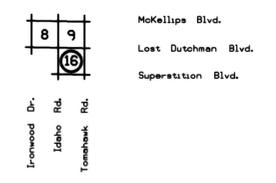

McLAIN HARBERS CO., INC

DESIGN	BY	DATE	FLOOD CONTROL DISTRICT OF MARICOPA COUNTY
DESIGN CHK.	-	-	
PLANS	-	-	RECOMMENDED BY: DATE
PLANS CHK.	-	-	APPROVED BY: DATE
SUBMITTED BY:			CHIEF ENGINEER AND GENERAL MANAGER
	DATE:		SHEET 3 OF 3

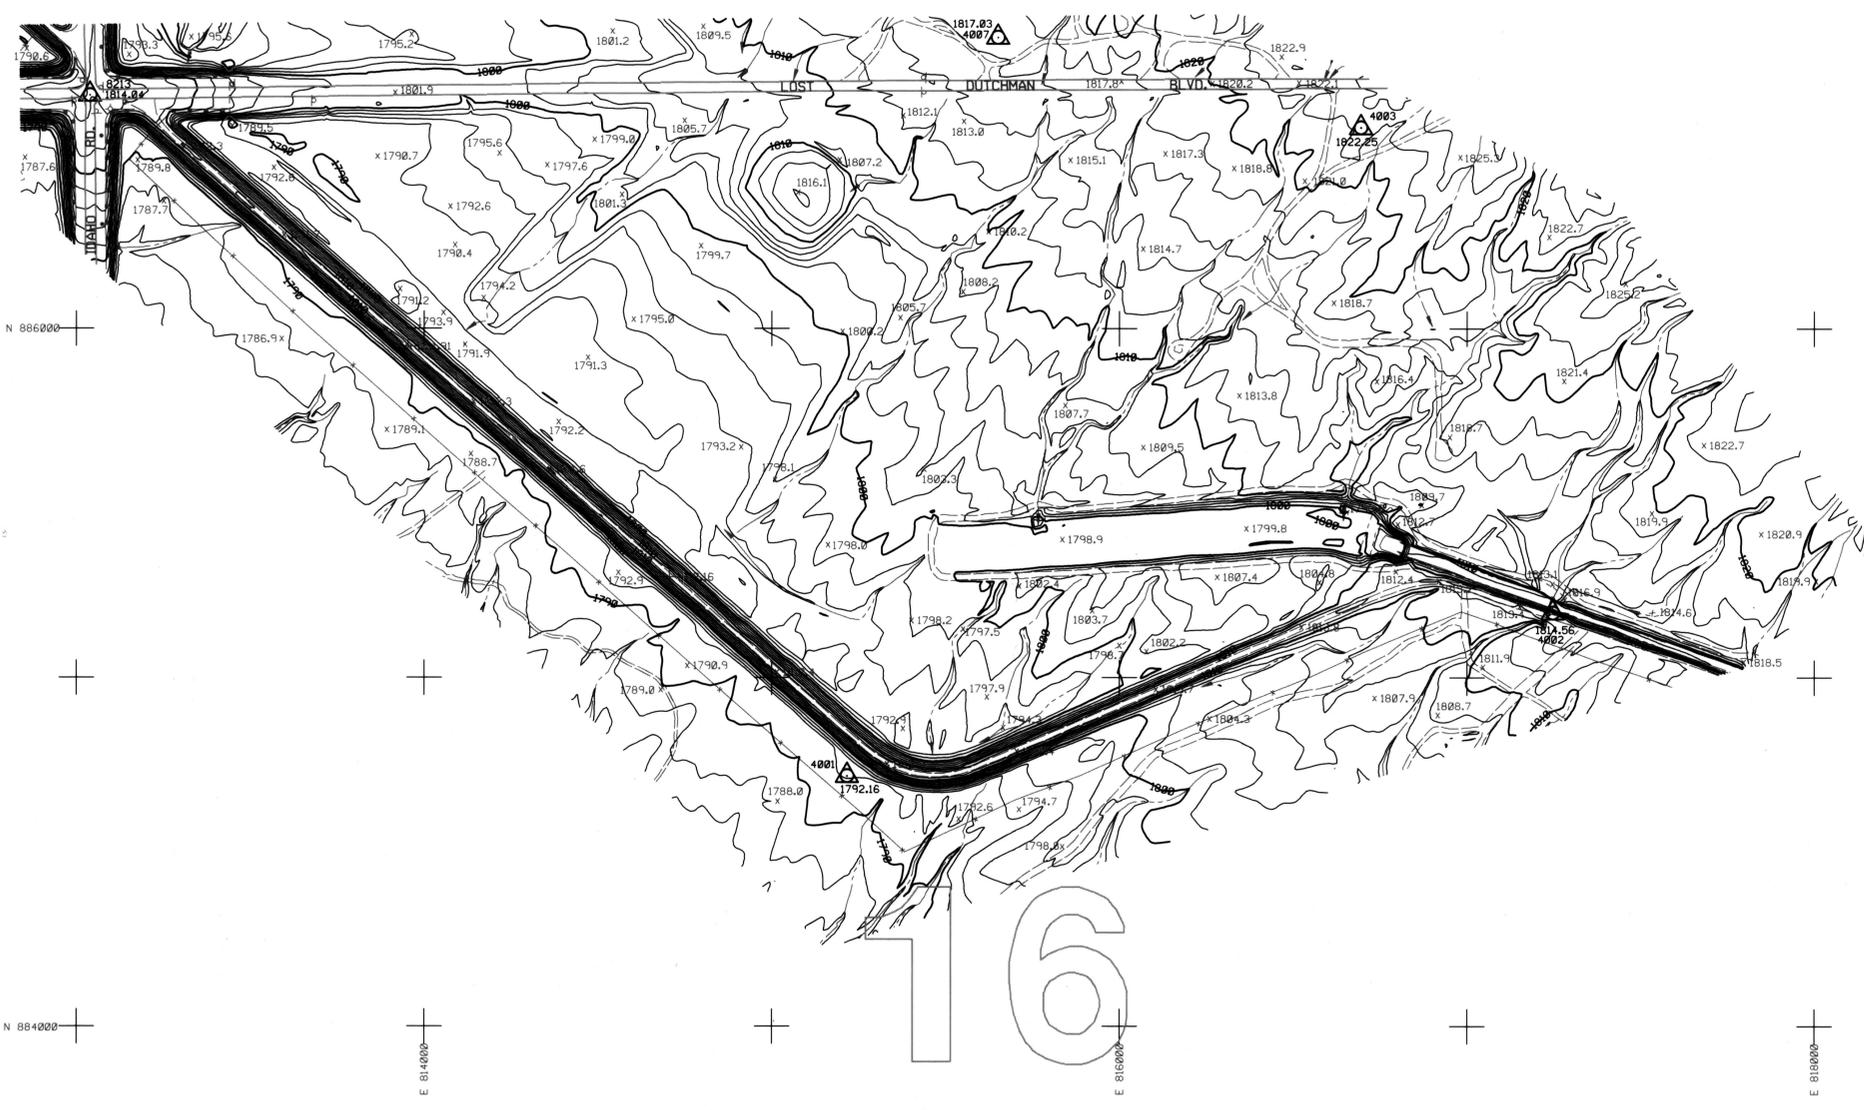

16