Interim Report
Arizona Canal Diversion
Channel Bridges
at Interstate 17
Phoenix, Arizona
for
RGA Consulting Engineers
Job No. 2125J066

WESTERN
TECHNOLOGIES
INC.

A118.930

RECEIVED
MAY 28 1985
HIGHWAY PLANS
SERVICES

Interim Report
Arizona Canal Diversion Channel Bridges at Interstate 17 Phoenix, Arizona
for
RGA Consulting Engineers
Job No. 2125J066

Property of
Flood Control District of MC Library
Please Return to
2801 W. Durango
Phoenix, AZ 85009

WESTERN TECHNOLOGIES INC.

Phoenix
3737 East Broadway Road
P.O. Box 21387
Phoenix, Arizona 85036
(602) 437-3737

Flagstaff
2400 East Huntington Drive
Flagstaff, Arizona 86001
(602) 774-8708

Pinetop
H C 62 Box 19981
Pinetop, Arizona 85935
(602) 367-3011

Tucson
423 South Olsen Avenue
Tucson, Arizona 85719
(602) 624-8894

Sierra Vista
1827 South Paseo San Luis
Sierra Vista, Arizona 85635
(602) 458-0364

Albuquerque
3808 Academy Parkway North, N.E.
Albuquerque, New Mexico 87109
(505) 345-6586

Farmington
400 South Lorena Avenue
Farmington, New Mexico 87401
(505) 327-4966

Las Vegas
300 West Boston Avenue
Las Vegas, Nevada 89102
(702) 382-7483

Laughlin
460 Main Street
Bullhead City, Arizona 86430
(602) 754-2271

WESTERN TECHNOLOGIES INC.

3737 East Broadway Road
P.O. Box 21387
Phoenix, Arizona 85036
(602) 437-3737

RGA Consulting Engineers
1102 West Indian School Road
Phoenix, Arizona 85013

May 15, 1985

Attn: Mr. Harold Ditzler

Re: Interim Report
Arizona Canal Diversion Channel Bridges
at Interstate 17
Phoenix, Arizona

Job No. 2125J066

Our interim geotechnical report for the above project is attached. The work was performed according to our proposal of November 15, 1984. The scope of the field work was modified as the result of discussions with Mr. Dick Bruce of ADOT. The modified scope included drilling 2 borings to a depth of 100 feet and 6 borings to a depth of 40 feet.

Soils at the site consisted of firm to stiff sandy clays and clayey sands underlain by dense to very dense clayey sands, gravelly sands, sandy gravels, clayey sandy gravels and sandy clays. We recommend that the facility be founded on either spread footings, drilled piers, or driven piles.

The interim report completes Western Technologies Inc.'s current services for the preliminary design phase. The final report will be prepared following finalization of the structural system to be used.

Sincerely,
WESTERN TECHNOLOGIES INC.
Geotechnical Services

Kenneth L. Ricker, P.E.

jh

Copies to: Addressee (1)
RGA (Tucson) (5)

RGA Consulting Engineers
Job No. 2125J066

TABLE OF CONTENTS

	Page No.
INTRODUCTION	1
PROPOSED CONSTRUCTION	1
SITE CONDITIONS	1
SCOPE OF SERVICES	2
INTERPRETATION OF SUBSURFACE CONDITIONS	2
Exploration	2
Testing	3
PRELIMINARY CONCLUSIONS AND RECOMMENDATIONS	3
General	3
Foundations	3
Shallow	3
Deep - Drilled Piers	4
Deep - Driven Piles	5
Lateral Earth Pressures	6
Earthwork	7
General	7
Excavation	7
Foundation Preparation	7
Materials	7
Placement and Compaction	8
Compliance	9
CLOSURE	9
APPENDIX	
Terminology	A-1
Soil Classification	A-2
Laboratory Test Data	A-3
Boring Log Notes	A-7
Logs of Borings	A-8
Site Plan	A-28

RGA Consulting Engineers
Job No. 2125J066

Geotechnical Investigation
Interim Report
Arizona Canal Diversion Channel Bridges
at Interstate 17
Phoenix, Arizona
May 15, 1985

INTRODUCTION

This report contains the results of our geotechnical investigation for the proposed bridges over the Arizona Canal Diversion Canal to be located along Interstate-17 in Phoenix, Arizona. The bridges will be located along the existing I-17 right-of-way just north of the Arizona Canal. The purpose of these services is to provide information and recommendations relative to foundation design, lateral earth pressures, and approach fill grading.

PROPOSED CONSTRUCTION

The proposed project will include a bridge on the east frontage road, the west frontage road, and the north and south bound freeway. The bridges will be either one or two spans with a total bridge length of 110 feet. The clear height under the bridges will be at least 21 feet. The channel under the bridge will be concrete lined and rectangular in shape. The bridges will be either supported by shallow footings or deep foundations. If shallow footings are used, foundation loads will be on the order of 26 klf. If deep foundations are used, foundations founded at five foot centers will have loads of 105 to 185 kips.

SITE CONDITIONS

At the time of our exploration, the site was occupied by the existing freeway and adjoining frontage roads. The area contained some landscape materials and underground and overhead utilities.

SCOPE OF SERVICES

Eight borings were drilled to depths of 41 to 100 feet at the locations shown on the site plan. During exploration, subsoils were examined visually and sampled at selected intervals.

The following tests were performed on selected soil samples:

- Water content
- Dry density
- Consolidation
- Expansion
- Shear strength
- Gradation
- Plasticity
- R-Value

Test results were used in the development of foundation and earthwork recommendations.

INTERPRETATION OF SUBSURFACE CONDITIONS

Exploration: As presented on Logs of Borings, surface and subsoils to the full depth of exploration were found to be alluvial soils consisting of interbedded deposits of sandy clay, clayey sand, sandy gravel, gravelly sand, clayey sand and gravel, and silty sand. In Borings 1, 2, and 7 the upper 2 to 3 feet of the material is fill. In Borings 5, 6, and 8 these soils are overlain by 3 to 4 inches of asphalt concrete and 12 to 15 inches of aggregate base material. The soils to depths of 9 to 16 feet are medium dense (firm to stiff). Below these depths the soils are dense to very dense (very stiff to hard) except at Boring 2. In Boring 2, the soil becomes denser below a depth of 30 feet. A groundwater table was not encountered in any boring at the time of exploration.

Testing: Laboratory test results indicate that native subsoils at shallow foundation level are slightly to moderately compressible at existing water contents. Slight additional compression occurs when the water content is increased. When water is added to compacted near-surface clay soils, moderate expansion occurs. The soils at shallow foundation level have moderate shear strengths.

PRELIMINARY CONCLUSIONS AND RECOMMENDATIONS

General: The recommendations presented in this report are based on the preliminary design concepts and on the assumption that the soil conditions do not deviate appreciably from those disclosed by the borings. The final report will be prepared upon completion of preliminary designs.

Foundations: Because of variations in the nature of bearing soils, foundation bearing levels, and structural load grades, we considered the following foundation systems:

- shallow foundations on undisturbed subsoils
- deep foundations consisting of drilled piers founded on undisturbed subsoils
- deep foundations consisting of driven piles founded in the undisturbed subsoils

- Shallow Foundations: We recommend spread foundations bearing upon undisturbed subsoils, below the bottom of the proposed channel for the anticipated loading conditions.

  Footing depth and design bearing capacity are presented in the following tabulation:

Footing Depth Below Finished Grade (ft)	Design Bearing Capacity (psf)*
2.0	8000

*Design bearing capacities assume fulfillment of "Earthwork" recommendations.

Total or differential settlements resulting from the assumed loads are estimated to be less than 1-3/8 inches provided that:

- Foundations are constructed as we recommend, and
- Essentially no changes occur in water contents of foundation soils.

Additional foundation movements of up to 1/4 inch could occur if water from any source infiltrates the foundation soils; therefore, proper drainage should be provided in the final design and during construction.

Finished grade is the lowest adjacent channel grade for abutment and pier footings. The design bearing capacity applies to dead loads plus design live load conditions. The design bearing capacity may be increased by one-third when considering total loads that include wind or seismic. Recommended minimum width of footings is 24 inches.

Foundation excavations into undisturbed soils should be inspected by the geotechnical engineer. If the soil conditions encountered differ significantly from those presented in this report, supplemental recommendations will be required.

- Deep Foundations - Drilled Piers: We recommend a drilled pier foundation system. The following capacities should be used in design for straight, shaft, machine-cleaned, 2-foot diameter piers:

Depth* (ft)	Total Capacity (kips)
10	109
16	165
17	185

*Depth measured from bottom of channel

Bearing capacity may be increased one-third when considering total loads including wind and seismic.

Estimated settlements for drilled piers are 1/2 inch or less for maximum loads.

Drilling to design depths should be possible with conventional rotary or bucket augers. Shafts will probably remain open without stabilizing measures. However, caving and sloughing should be anticipated in the relatively clean granular soils. Due to potential sloughing and raveling, foundation concrete quantities may exceed calculated geometric volumes.

The bearing surface must be machine cleaned prior to concrete placement. A representative of the geotechnical engineer should inspect the bearing surface and pier configuration without entering the drilled element.

- Deep Foundations - Driven Pile: We recommend low displacement H-piles driven into the alluvial soil. At present only one H-pile section has been considered because of anticipated lateral loads on the pile section. An allowable end bearing capacity for an HP 14 x 89 of 40 tons may be used in design.

The recommended minimum center to center spacing on the driven H-piles is three pile diameters in order to develop full capacity of each pile in the group. The settlement of pile groups, with the individual piles being loaded to the full design load, is expected to be on the order of 1/4 to 1/2 inch. This settlement should take place soon following load application.

Lateral Earth Pressures: For soils above any free water surface, recommended equivalent fluid pressures and coefficients of base friction for unrestrained elements for use in preliminary design are:

- Active:
  Undisturbed subsoil ---------- 35 psf/ft
  Compacted granular backfill ---------- 30 psf/ft
- Passive:
  Shallow wall footings ---------- 350 psf/ft
  Drilled Piers ---------- 500 psf/ft
- Coefficient of base friction ---------- 0.40*

*The coefficient of base friction should be reduced to 0.30 when used in conjunction with passive pressure.

Where the design includes restrained elements, the following equivalent fluid pressures are recommended:

- At-rest:
  Undisturbed subsoil ---------- 60 psf/ft
  Compacted granular backfill ---------- 55 psf/ft

The lateral earth pressures herein are not applicable for submerged soils. We should be consulted for additional recommendations if such conditions are to be included in the design. Once the design concept has been finalized, additional evaluations of the soil response to various lateral load conditions will be accomplished.

Fill against footings, stem walls, abutment walls, and retaining walls should be compacted to densities specified in "Earthwork." Medium to high plasticity clay soils should not be used as backfill against retaining walls. Compaction of each lift adjacent to walls should be accomplished with hand-operated tampers or other light-weight compactors. Overcompaction may cause excessive lateral earth pressures which could result in wall movements.

Earthwork:

- General:

  1. The conclusions contained in this report for the proposed construction are contingent upon compliance with recommendations presented in this section.

- Excavation:

  1. We anticipate that excavations for the proposed construction can be accomplished with conventional equipment.

- Foundation Preparation:

  1. Specialized treatment of existing soils within foundation areas is not required.

- Materials:

  1. On-site soils may be used as backfill against abutments or retaining walls.

  2. Imported soils should conform to the following:

- Gradation (ASTM C136): percent finer by weight

6"	100
4"	70-100
No. 4 Sieve	50-100
No. 200 Sieve	60 (max)

- Maximum expansive potential(%)* 1.5

- Maximum soluble sulfates(%) 0.10

*Measured on a sample compacted to approximately 95 percent of the ASTM D698 maximum dry density at about 3 percent below optimum water content. The sample is confined under a 100 psf surcharge and submerged.

3. Aggregate base should conform to ADOT specifications.

- Placement and Compaction:

1. Place and compact fill in horizontal lifts, using equipment and procedures that will produce recommended water contents and densities throughout the lift.

2. Uncompacted fill lifts should not exceed 6 inches.

3. Materials should be compacted to the following:

Material	Minimum Percent Compaction (ASTM D698)
On-site soils:	
Below pavement	95
Against subsurface walls	95
Imported fill:	
Below pavement	95
Against subsurface walls	95
Aggregate base	95
Miscellaneous backfill	90

4. On-site clay soils should be compacted within a water content range of 1 percent below to 4 percent above optimum. Imported soils should be compacted within a moisture range of 3 percent below to 3 percent above optimum.

- Compliance:

1. Recommendations for backfill and pavement elements supported on compacted fills or prepared subgrade depend upon compliance with "Earthwork" recommendations. To assess compliance, observation and testing should be performed under the direction of a geotechnical engineer.

CLOSURE

Our conclusions and recommendations are based on preliminary design concepts. Additional recommendation will be present in a final report upon selection of final design alternates.

DEFINITION OF TERMINOLOGY

ALLOWABLE SOIL BEARING CAPACITY ALLOWABLE FOUNDATION PRESSURE	The recommended maximum contact stress developed at the interface of the foundation element and the supporting material.
BACKFILL	A specified material placed and compacted in a confined area.
BASE COURSE	A layer of specified material placed on a subgrade or subbase.
BASE COURSE GRADE	Top of base course.
BENCH	A horizontal surface in a sloped deposit.
CAISSON	A concrete foundation element cast in a circular excavation which may have an enlarged base. Sometimes referred to as a cast-in-place pier.
CONCRETE SLABS-ON-GRADE	A concrete surface layer cast directly upon a base, subbase or subgrade.
CRUSHED ROCK BASE COURSE	A base course composed of crushed rock of a specified gradation.
DIFFERENTIAL SETTLEMENT	Unequal settlement between or within foundation elements of a structure.
ENGINEERED FILL	Specified material placed and compacted to specified density and/or moisture conditions under observation of a representative of a soil engineer.
EXISTING FILL	Materials deposited through the action of man prior to exploration of the site.
EXISTING GRADE	The ground surface at the time of field exploration.
EXPANSIVE POTENTIAL	The potential of a soil to expand (increase in volume) due to the absorption of moisture.
FILL	Materials deposited by the action of man.
FINISHED GRADE	The final grade created as a part of the project.
GRAVEL BASE COURSE	A base course composed of naturally occurring gravel with a specified gradation.
HEAVE	Upward movement.
NATIVE GRADE	The naturally occurring ground surface.
NATIVE SOIL	Naturally occurring on-site soil.
ROCK	A natural aggregate of mineral grains connected by strong and permanent cohesive forces. Usually requires drilling, wedging, blasting or other methods of extraordinary force for excavation.
SAND AND GRAVEL BASE	A base course of sand and gravel of a specified gradation.
SAND BASE COURSE	A base course composed primarily of sand of a specified gradation.
SCARIFY	To mechanically loosen soil or break down existing soil structure.
SETTLEMENT	Downward movement.
SOIL	Any unconsolidated material composed of discrete solid particles, derived from the physical and/or chemical disintegration of vegetable or mineral matter, which can be separated by gentle mechanical means such as agitation in water.
STRIP	To remove from present location.
SUBBASE	A layer of specified material placed to form a layer between the subgrade and base course.
SUBBASE GRADE	Top of subbase.
SUBGRADE	Prepared native soil surface.

METHOD OF SOIL CLASSIFICATION
(ASTM D 2487)

COARSE-GRAINED SOILS

LESS THAN 50% FINES*

GROUP SYMBOLS	DESCRIPTION	MAJOR DIVISIONS
GW	WELL-GRADED GRAVELS OR GRAVEL-SAND MIXTURES, LESS THAN 5% FINES	GRAVELS More than half of coarse fraction is larger than No. 4 sieve size
GP	POORLY-GRADED GRAVELS OR GRAVEL-SAND MIXTURES, LESS THAN 5% FINES	
GM	SILTY GRAVELS, GRAVEL-SAND-SILT MIXTURES, MORE THAN 12% FINES	
GC	CLAYEY GRAVELS, GRAVEL-SAND-CLAY MIXTURES, MORE THAN 12% FINES	
SW	WELL-GRADED SANDS OR GRAVELLY SANDS, LESS THAN 5% FINES	SANDS More than half of coarse fraction is smaller than No. 4 sieve size
SP	POORLY-GRADED SANDS OR GRAVELLY SANDS, LESS THAN 5% FINES	
SM	SILTY SANDS, SAND – SILT MIXTURES, MORE THAN 12% FINES	
SC	CLAYEY SANDS, SAND-CLAY MIXTURES, MORE THAN 12% FINES	

NOTE:
Coarse grained soils receive dual symbols if they contain 5 to 12% fines (e.g. SW-SM, GP-GC, etc.)

FINE-GRAINED SOILS

MORE THAN 50% FINES*

GROUP SYMBOLS	DESCRIPTION	MAJOR DIVISIONS
ML	INORGANIC SILTS, VERY FINE SANDS, ROCK FLOUR, SILTY OR CLAYEY FINE SANDS	SILTS AND CLAYS Liquid limit less than 50
CL	INORGANIC CLAYS OF LOW TO MEDIUM PLASTICITY, GRAVELLY CLAYS, SANDY CLAYS, SILTY CLAYS, LEAN CLAYS	
OL	ORGANIC SILTS OR ORGANIC SILTY-CLAYS OF LOW PLASTICITY	
MH	INORGANIC SILTS, MICACEOUS OR DIATOMACEOUS FINE SANDS OR SILTS, ELASTIC SILTS	SILTS AND CLAYS Liquid Limit more than 50
CH	INORGANIC CLAYS OF HIGH PLASTICITY, FAT CLAYS	
OH	ORGANIC CLAYS OF MEDIUM TO HIGH PLASTICITY	
PT	PEAT, MUCK, AND OTHER HIGHLY ORGANIC SOILS	HIGHLY ORGANIC SOILS

NOTE:
Fine grained soils receive dual symbols if their limits plot in the hatched zone on the Plasticity Chart (ML-CL)

SOIL SIZES

COMPONENT	SIZE RANGE
BOULDERS	ABOVE 12 in.
COBBLES	3 in. to 12 in.
GRAVEL	No. 4 to 3 in.
Coarse	¾ in. to 3 in.
Fine	No. 4 to ¾ in.
SAND	No. 200 to No. 4
Coarse	No. 10 to No. 4
Medium	No. 40 to No. 10
Fine	No. 200 to No. 40
*FINES (Silt or Clay)	BELOW No. 200

NOTE:
Only sizes smaller than three inches are used to classify soils.

PLASTICITY CHART

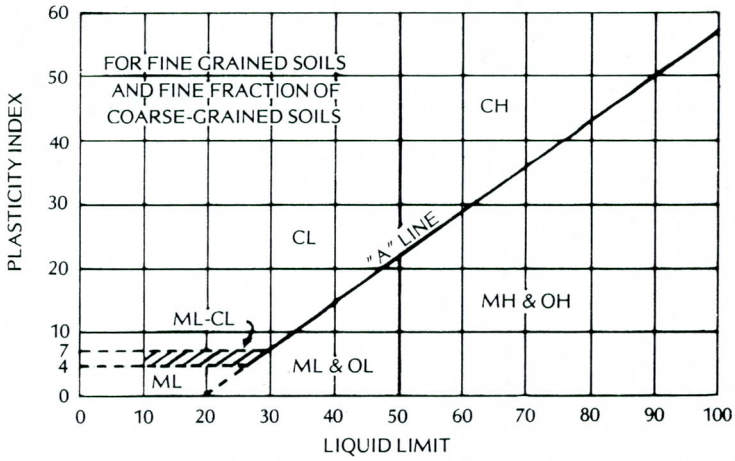

237

SOIL PROPERTIES

Job No. 2125J066

Boring No.	Depth, ft.	Soil Class.	Expansion/Compression					Water Soluble Matter, %		Shear Strength					Consolidation		
			Initial Dry Density pcf	Initial Moisture Content, %	Surcharge KSF	+ Expan. - Comp. %	Max. Swell Pressure KSF	Salts	Sulfates	Test Method	Initial Moisture Content, %	Dry Density pcf	C KSF	∅ Deg.	Initial Void Ratio	Surcharge KSF	Consol. %
1	3 - 5	SC	112.1(1)	11.1(4)	0.1	+2.8(5)											
1	5 - 6	SC								UC	12.3	112.9	1.085				
1	25 - 26	SC	98.8(1)	16.9(4)	0.56	-0.50											
1	25 - 26	SC	98.8(1)	16.9(4)	1.10	-1.04											
1	25 - 26	SC	98.8(1)	16.9(4)	2.22	-1.52											
1	25 - 26	SC	98.8(1)	16.9(4)	4.42	-2.31											
1	25 - 26	SC	98.8(1)	16.9(4)	8.84	-3.27											
1	25 - 26	SC	98.8(1)	16.9(4)	17.70	-4.78											
1	25 - 26	SC	98.8(1)	16.9(4)	35.40	-9.32											
1	25 - 26	SC	98.8(1)	16.9(4)	35.40(5)	-9.32											

Boring No.	Depth, ft.	Remarks

LEGEND

Shear Strength Test Method
- DS Direct Shear
- DS Direct Shear (saturated)
- UC Unconfined Compression
- UU Unconsolidated Undrained
- CU Consolidated Undrained w/pore press
- CU Consolidated Undrained
- CD Consolidated Drained
- CR Cyclic Consolidated Undrained w/pore press

REMARKS

1. In-situ density.
2. Compacted density (Approx. 95% of ASTM:D698 max. density at moisture content slightly below optimum).
3. Compacted density (Approx. 95% of ASTM:D1557 max. density at moisture content slightly below optimum).
4. In-situ moisture.
5. Submerged to approximate saturation.
6. Consolidation % upon saturation.
7.

SOIL PROPERTIES

Job No. 2125J066

Boring No.	Depth, ft.	Soil Class.	Expansion/Compression					Water Soluble Matter, %		Shear Strength					Consolidation		
			Initial Dry Density pcf	Initial Moisture Content, %	Surcharge KSF	+ Expan. - Comp. %	Max. Swell Pressure KSF	Salts	Sulfates	Test Method	Initial Moisture Content, %	Dry Density pcf	C KSF	∅ Deg.	Initial Void Ratio	Surcharge KSF	Consol. %
3	35 - 36	SC								DS	16.7(4)	110.7(1)	1.40	33.7			
5	25 - 26	SC								DS	17.8(4)	98.4(1)	1.40	34.4			
6	30 - 31	CL	101.9(1)	20.2(4)	0.56	-0.62											
6	30 - 31	CL	101.9(1)	20.2(4)	1.10	-1.17											
6	30 - 31	CL	101.9(1)	20.2(4)	2.20	-1.92											
6	30 - 31	CL	101.9(1)	20.2(4)	4.42	-2.96											
6	30 - 31	CL	101.9(1)	20.2(4)	8.84	-4.58											
6	30 - 31	CL	101.9(1)	20.2(4)	17.70	-7.12											
6	30 - 31	CL	101.9(1)	20.2(4)	35.40	-11.21											
6	30 - 31	CL	101.9(1)	20.2(4)	35.40(5)	-11.21											

Boring No.	Depth, ft.	Remarks

LEGEND

Shear Strength Test Method
- DS Direct Shear
- DS Direct Shear (saturated)
- UC Unconfined Compression
- UU Unconsolidated Undrained
- CU Consolidated Undrained w/pore press
- CU Consolidated Undrained
- CD Consolidated Drained
- CR Cyclic Consolidated Undrained w/pore press

REMARKS

1. In-situ density.
2. Compacted density (Approx. 95% of ASTM:D698 max. density at moisture content slightly below optimum).
3. Compacted density (Approx. 95% of ASTM:D1557 max. density at moisture content slightly below optimum).
4. In-situ moisture.
5. Submerged to approximate saturation.
6. Consolidation % upon saturation.
7.

SOIL PROPERTIES

Job No. 2125J066

Boring No.	Depth, ft.	Soil Class.	Expansion/Compression					Water Soluble Matter, %		Shear Strength					Consolidation		
			Initial Dry Density pcf	Initial Moisture Content, %	Surcharge KSF	+ Expan. - Comp. %	Max. Swell Pressure KSF	Salts	Sulfates	Test Method	Initial Moisture Content, %	Dry Density pcf	C KSF	∅ Deg.	Initial Void Ratio	Surcharge KSF	Consol. %
7	2 - 5	CL	118.6 (2)	16.2	0.1	+3.8 (5)											
8	30 - 31	SC								DS	22.5 (4)	100.9 (1)	1.22	36.3			

Boring No.	Depth, ft.	Remarks

LEGEND

Shear Strength Test Method
- DS Direct Shear
- DS Direct Shear (saturated)
- UC Unconfined Compression
- UU Unconsolidated Undrained
- CU Consolidated Undrained w/pore press
- CU Consolidated Undrained
- CD Consolidated Drained
- CR Cyclic Consolidated Undrained w/pore press

REMARKS

1. In-situ density.
2. Compacted density (Approx. 95% of ASTM:D698 max. density at moisture content slightly below optimum).
3. Compacted density (Approx. 95% of ASTM:D1557 max. density at moisture content slightly below optimum).
4. In-situ moisture.
5. Submerged to approximate saturation.
6. Consolidation % upon saturation.
7.

PHYSICAL PROPERTIES

Job No. 2125J066

Boring No.	Depth, ft.	Soil Class.	Particle Size Distribution, % Passing by wt.					Atterberg Limits		Moisture - Density Rel.			Specific Gravity	Permeability		'R' Value	Remarks
			3"	#4	#10	#40	#200	LL	PI	Dry Density pcf	Optimum Moisture %	Meth.		Dry Density pcf	K Cm/Sec	Corrected 'R'	
1	0 - 3	SC/CL														20	12
1	3 - 5	SC					45	25	8								3
7	2 - 5	CL					74	38	18								3

Boring No.	Depth, ft.	Comments

REMARKS

Classification/Particle Size
1. Visual
2. Laboratory Tested
3. Minus #200 Only

Moisture Density Relationship
4. Tested ASTM D-689/AASHTO T-99
5. Tested ASTM D-1557/AASHTO T-180
6. Other_____

Specific Gravity
7. Minus #4
8. Plus #4

Permeability
9. Constant Head
10. Falling Head

'R' Value
11. Expansion Pressure_____psf
12. Exudation Pressure 300 psi

Note: NP = nonplastic

BORING LOG NOTES

The number shown in "LOG OF BORING NO." refers to the approximate location of the same number indicated on the "Site Plan" as positioned in the field by pacing from property lines and/or existing features.

"TYPE/SIZE BORING" refers to the exploratory equipment used in the boring wherein HSA = hollow-stem auger.

"N" in "Blows/Foot" refers to the number of blows of a 140-pound weight, dropped 30 inches, required to advance a two-inch-outside-diameter split-barrel sampler a distance of 1 foot, Standard Penetration Test (ASTM D1586). Refusal to penetration is defined as more than 100 blows per foot.

"R" in "Blows/Foot" refers to the number of blows of a 140-pound weight, dropped 30 inches, required to advance a 2.42-inch-inside-diameter ring sampler a distance of 1 foot. Refusal to penetration is considered more than 50 blows per foot.

"Sample Type" refers to the form of sample recovery, in which N = Split-barrel sample, R = Ring sample, and G = Grab sample.

"Dry Density, pcf" refers to the laboratory-determined dry density in pounds per cubic foot. The symbol "NR" indicates that no sample was recovered. The symbol "*" indicates that determination of dry density was not possible.

"Moisture Content, %" refers to the laboratory-determined moisture content in percent (ASTM D2216).

"Unified Class" refers to the soil type as defined by "Method of Soil Classification". The soils were classified visually in the field and, where appropriate, classifications were modified by visual examination of samples in the laboratory and/or by appropriate tests.

These notes and boring logs are intended for use in conjunction with the purposes of our services defined in the text. Boring log data should not be construed as part of the construction plans nor as defining construction conditions.

Boring logs depict our interpretations of subsurface conditions at the locations and on the date(s) noted. Variations in subsurface conditions and soil characteristics may occur between borings. Groundwater levels may fluctuate due to seasonal variations and other factors.

In general, terms and symbols on the boring logs conform with "Standard Definitions of Terms and Symbols Relating to Soil and Rock Mechanics" (ASTM D653).

LOG OF BORING NO. 1

Project ACDC Bridge Job No. 2125J066

Elevation 1234.46 Datum N.G.S.

Type/Size Boring 7" HSA Rig Type CME 75 Date 3/19/85

Groundwater Conditions No Groundwater Encountered

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
			G			SC/CL	CLAYEY SAND/SANDY CLAY; some silt, fill, brown, poorly compacted, firm to stiff, near PL
5		10	G R	113	12.3	SC	CLAYEY SAND; with silt, trace gravel, brown, medium dense, damp
10			G			CL	SANDY CLAY; some silt, brown, stiff, near PL
		9	N			SC	CLAYEY SAND; with silt, trace gravel, brown, medium dense, damp
15		50	R	128	2.2	SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
20		57	G N				
25		43	R	99	16.9	SC	CLAYEY SAND; with silt and gravel, brown, dense to very dense, damp
30							Trace gravel

LOG OF BORING NO. 1 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
31		48	N			SC	CLAYEY SAND; (Cont'd)
35		50	R	115	7.9	SP	GRAVELLY SAND; trace silt and cobbles, light brown, dense to very dense, damp
40		36	N			SC	CLAYEY SAND; with silt and gravel, brown, dense to very dense, damp
45							Stopped @ 41.5 feet
50							
55							
60							

LOG OF BORING NO. 2

Project ACDC Bridge Job No. 2125J066

Elevation 1234.84 Datum N.G.S.

Type/Size Boring 7" HSA Rig Type CME 75 Date 3/19/85

Groundwater Conditions No Groundwater Encountered

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
						GP	SANDY GRAVEL; some silt, fill, brown, poorly compacted, loose, damp
						SC	CLAYEY SAND; with silt, trace gravel, brown, medium dense, damp
5		8	N			CL	SANDY CLAY; some silt, brown, stiff, near PL
10		28	R	107	18.1		
						SC	CLAYEY SAND; with silt, trace gravel, brown, medium dense, damp
15		39	N			SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
20		22	R	101	18.0	SC	CLAYEY SAND; with silt, trace gravel, brown, medium dense, damp
25		20	N				More sand and gravel
30							

LOG OF BORING NO. 2 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
31		50/8"	R	*	3.7	SC	CLAYEY SAND; with silt and gravel, brown, dense to very dense, damp
35		92	N				
40		50/9"	R	NR			
							Stopped @ 41 feet
45							
50							
55							
60							

LOG OF BORING NO. 3

Project ACDC Bridge — Job No. 2125J066

Elevation 1231.28 — Datum N.G.S.

Type/Size Boring 7" HSA — Rig Type CME75/CME 45 — Date 3/22/85 3/27/85

Groundwater Conditions No Groundwater Encountered

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
5		27	R	109	19.2	CL	SANDY CLAY; some silt, brown, stiff, near PL
						SC	CLAYEY SAND; with silt, trace gravel, brown, medium dense, damp
10		25	N			SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
15		50/8"	R	122	7.7		
20		36	N			SC	CLAYEY SAND; with silt and gravel, brown, dense to very dense, damp
25		44	R	115	12.9		Trace gravel, more clay, light cementation
30							

LOG OF BORING NO. 3 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
31		48	N			SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
							More gravel
35						SC	CLAYEY SAND; with silt and gravel, brown, dense to very dense, damp
		50/8"	R	111	16.7		
40						SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
							With cobbles
		100/1"	N	NR			
45							
		100/1"	N	NR			
50		169	N			SC-GC	CLAYEY SAND AND GRAVEL; some silt, trace cobbles, brown, dense to very dense, damp
55							
							Some cobbles
60							

LOG OF BORING NO. 3 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
61		100/6"	N			SC-GC	CLAYEY SAND AND GRAVEL; (Cont'd)
65							
70							
		100/6"	N			SC	CLAYEY SAND; with silt and gravel, brown, dense to very dense, damp
75							
80							
		172/9"	N				
							More clay, trace gravel
85							
							More gravel, trace cobbles
90							

LOG OF BORING NO. 3 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
91						SC	CLAYEY SAND; (Cont'd)
		137	N			CL	SANDY CLAY; brown, hard, -PL
95							
						SC	CLAYEY SAND; with silt and gravel, brown, dense to very dense, damp
100							
							Stopped @ 100 feet
105							
110							
115							
120							

LOG OF BORING NO. 4

Project ACDC Bridge — Job No. 2125J066

Elevation 1232.50 — Datum N.G.S.

Type/Size Boring 7" HSA — Rig Type CME 45/CME 75 — Date 3/27/85 4/22/85

Groundwater Conditions No Groundwater Encountered

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
5			G			CL	SANDY CLAY; some silt, brown, stiff, near PL
		7	N			SC	CLAYEY SAND; with silt, light brown, loose, damp
10			G				
		46	R	125	4.3	SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
			G				Coarser gravel
15		75	N				Trace clay
20						SC	CLAYEY SAND; some silt, light brown, light cementation, dense to very dense, damp
		39	R	98	19.8		
			G				
25		36	N				More silt, slightly finer sand, slightly lower plasticity
			G			CL	SANDY CLAY; some silt, brown, very stiff to hard, -PL
30							

LOG OF BORING NO. 4 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
31		45	R	100	22.1	CL	SANDY CLAY; (Cont'd)
35		40	N			SM	SILTY SAND; some clay, trace gravel, brown, dense to very dense, damp
40		37	N			SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp Some cobbles
45		153	N				Trace clay
50		100/4"	N				Some clay
55							
60							

LOG OF BORING NO. 4 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
61		128	N			SP/GP	GRAVELLY SAND/SANDY GRAVEL; (Cont'd)
65							Coarser gravel and cobbles 64-67 feet
70		173	N				
75							
80		156/10"	N			CL	SANDY CLAY; brown, hard, -PL
85							Some gravel
90						SC	CLAYEY SAND; with silt and gravel, brown, dense to very dense, damp

LOG OF BORING NO. 4 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
91		100/4"	N			SC	CLAYEY SAND; (Cont'd)
95							
100							
							Stopped @ 100 feet
105							
110							
115							
120							

LOG OF BORING NO. 5 Sta. 583+38

Project ACDC Bridge Job No. 2125J066

Elevation _____ Datum _____

Type/Size Boring 7" HSA Rig Type CME 45 Date 3/30/85

Groundwater Conditions No Groundwater Encountered

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
							3 inches asphaltic concrete on 15 inches of aggregate base
5		25	R	114	13.8	SC	CLAYEY SAND; with silt, trace gravel, fill, brown, moderately compacted, medium dense, damp
10		20	N			CL	SANDY CLAY; some silt, brown, stiff, near PL
15		38	R	119	2.0	SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
20		54	N				More coarse gravel Trace clay
25		30	R	98	17.8	SC	CLAYEY SAND; some silt, light brown, light cementation, dense to very dense, damp
30						CL	SANDY CLAY; some silt, brown, very stiff to hard, -PL

Sta. 583+38

LOG OF BORING NO. 5 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
31		44	N			CL	SANDY CLAY; (Cont'd)
35		43	R	101	20.4	SM	SILTY SAND; some clay, trace gravel, brown, dense to very dense, damp
40		100/6"	N			SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
45							Stopped @ 41.5 feet
50							
55							
60							

LOG OF BORING NO. 6 Sta. 582+70

Project ACDC Bridge Job No. 2125J066

Elevation _____ Datum _____

Type/Size Boring 7" HSA Rig Type CME 45 Date 3/30/85

Groundwater Conditions No Groundwater Encountered

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
							4 inches asphaltic concrete on 12 inches aggregate base
5		6	N			CL	SANDY CLAY; some silt, brown, stiff, near PL
10							Less moisture, coarser sand
		14	R	107	18.2	SC	CLAYEY SAND; with silt, trace gravel, brown, medium dense, damp
15		44	N			SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
20		50	R	114	5.6		Trace clay
25		37	N			SC/CL	CLAYEY SAND/SANDY CLAY; some silt, brown, very light cementation, hard, -PL
30						CL	SANDY CLAY; some silt, brown, very stiff to hard, -PL

Sta. 582+70

LOG OF BORING NO. 6 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
31		35	R	102	20.2	CL	SANDY CLAY; (Cont'd)
35		27	N			SP	GRAVELLY SAND; some silt, brown, medium dense to dense, damp
40		45	R	121	2.6		More gravel
45							Stopped @ 41 feet
50							
55							
60							

LOG OF BORING NO. 7

Project ACDC Bridge — Job No. 2125J066

Elevation 1235.98 — Datum N.G.S.

Type/Size Boring 7" HSA — Rig Type CME 45 — Date 3/30/85

Groundwater Conditions No Groundwater Encountered

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
						SC/CL	CLAYEY SAND/SANDY CLAY; some silt, fill, brown, poorly compacted, firm to stiff, near PL
5			G			CL	SANDY CLAY; some silt, brown, stiff, near PL
		13	R	104	15.8		
							Trace gravel, slightly less moisture
10		20	N				More sand, very stiff
15		15	R	106	6.7	SP	GRAVELLY SAND; some silt, brown, medium dense to dense, damp
20			G			SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
		81	N				
25							More gravel
		45	R	102	23.1		With clay, less gravel
30						SC	CLAYEY SAND; some silt, light brown, light cementation, dense to very dense, damp

LOG OF BORING NO. 7 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
31		39	N			SC	CLAYEY SAND; (Cont'd)
35		50/10"	R	118	7.6	SM	SILTY SAND; some clay, trace gravel, brown, dense to very dense, damp
40						SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
45							Stopped @ 40 feet
50							
55							
60							

LOG OF BORING NO. 8 Sta. 583+00

Project ACDC Bridge Job No. 2125J066

Elevation _____ Datum _____

Type/Size Boring 7" HSA Rig Type CME 45 Date 3/31/85

Groundwater Conditions No Groundwater Encountered

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
							3 inches asphaltic concrete on 15 inches of aggregate base
5		6	G N			CL	SANDY CLAY; some silt, brown, stiff, near PL
10							Less moisture, -PL
		31	R G	104	20.3	SC/ CL	CLAYEY SAND/SANDY CLAY; some silt, brown, dense to very dense, damp
15		44	N G			SP/ GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
20		22	R G	100	19.9	CL	SANDY CLAY; some silt, brown, very stiff to hard, -PL
25		40	N			SC	CLAYEY SAND; with silt and gravel, brown, dense to very dense, damp
30							

Sta. 583+00

LOG OF BORING NO. 8 CONTINUED

Project ACDC Bridge Job No. 2125J066

Depth, feet	Blows/Foot C	Blows/Foot N/R	Sample Type	Dry Density pcf	Moisture Content, %	Unified Classification	Description
31		50/9"	R	101	22.5	SC	CLAYEY SAND; (Cont'd)
35		124	N			SP/GP	GRAVELLY SAND/SANDY GRAVEL; some silt, brown, dense to very dense, damp
40		50/9"	R	105	4.5		
45							Stopped @ 41 feet
50							
55							
60							

JOB NO. 2125J066

REFERENCE: AERIAL PHOTO, NOT DATED

Prepared By SDV Date 5/14/85 Checked By Date
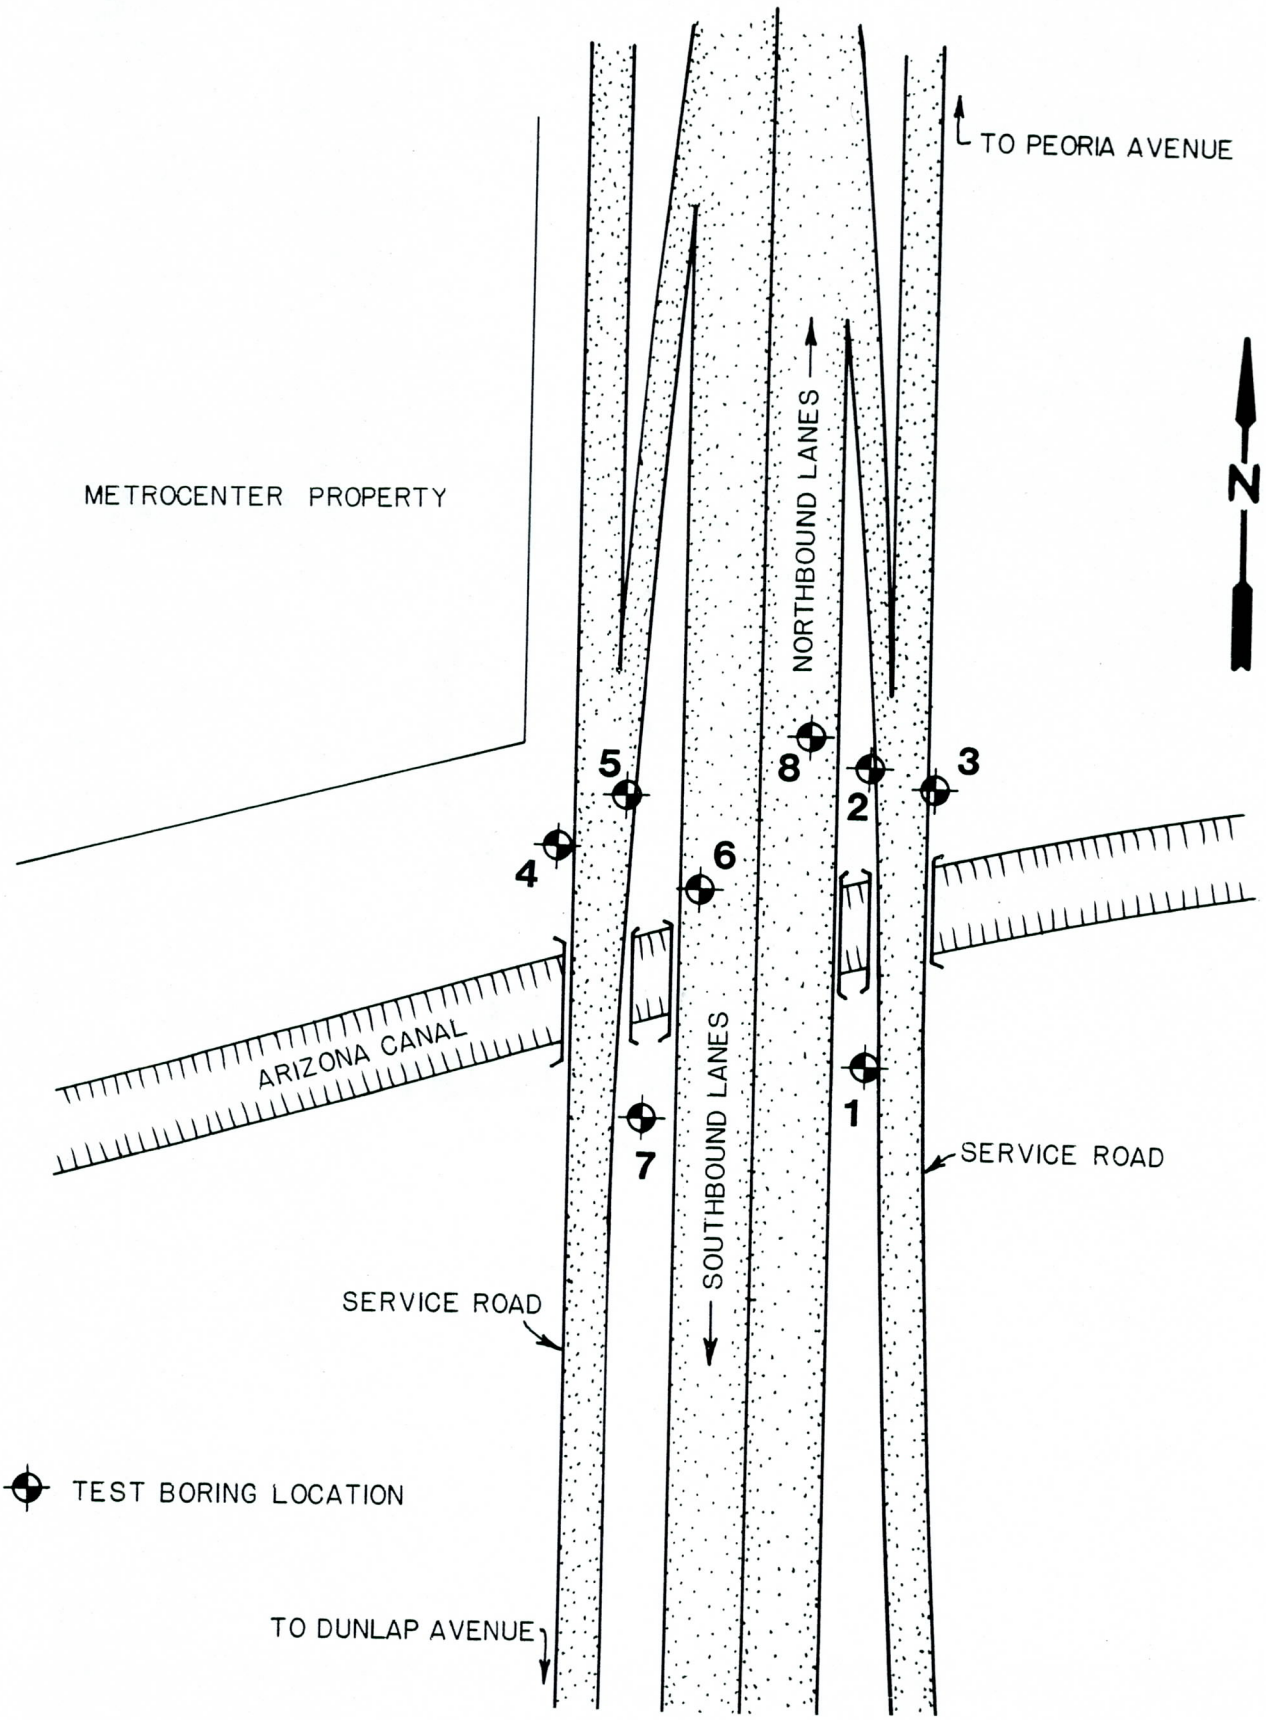
Site Plan